# **Installation- & Operation manual**

**Micatrone**<sup>®</sup>

[Doc.id: mi-306gb\_180528]

# Micaflex PFTT ver 3. Pressure- and Flow transmitter with purging function for flow sensor

MF-PFTT ver 3.x

**NOTE!** Read through the entire manual before you begin installation and programming.

## **APPLICATION**

MF-PFTT is a microprocessor controlled transmitter/ controller for measurement and control of differential pressure, flow or temperature. With an external temperature sensor, the flow measurement can be compensated for variations in the temperature. With an optional purging unit, PU3, the connected flow sensor can automatically be purged with set intervals. With the four keys on the front panel it is possible to access all functions, make settings and scaling the output signal. The double row, 2x16 character, LCD with backlight displays functions and values.

#### MOUNTING

MF-PFTT is designed for wall mounting but can be fitted with an optional frame kit, MFM-PANEL, for recessed mounting on wall or through a cabinet door. MF-PFTT is screwed to the wall using four screws, max Ø 4mm. Location of screw holes are shown on the backside of the enclosure. Unscrew the lid and use the bottom screws to temporarily fix the lid on the upper edge of the enclosure during installation. See figure.

## **OUTPUT SIGNAL**

MF-PFTT has two analogue output signals which can be used for pressure, flow, temperature or control signal. Each output has three terminals, one for Volt DC, one for mA DC and one common zero. The outputs allow both the Volt and mA signals to be used simultaneously.

With activated purging function, the purging unit PU3 is connected to output 1 (Volt or mA). If the unit is fitted with built-in automatic zero-setting module MFM-ZP, it is connected to output 2 (Volt or mA). It is still possible to use the free output signal on both outputs for the selected source.


#### ALARM

MF-PFTT has two alarms, each independent of the other. The alarm is acoustic with beeper and visual with LED indication for pressure, flow or temperature. High or low alarm level and manual or automatic reset.

## START MENU

When the transmitter is connected to supply voltage, a start menu is displayed.

Using the arrow-keys it is possible to scroll through the different available start menus. To have the unit always displaying the same start menu, it can be selected and programmed in parameter group **System settings**. By pressing the **ESC**-key when other menus are displayed the selected start menu is displayed.

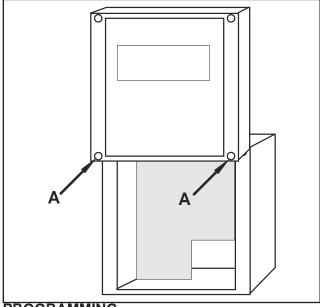

## **PROGRAMMING**

Push the **PGM**-key until "PROGRAM-MENU" is displayed. Release the **PGM**-key and the first parameter group is displayed according to the parameter list on page 2.

Using the arrow-keys it is possible to scroll through the different available parameter groups. **Note**, If code lock is activated, see page 7, the programmed 4-digit access code must be entered to access the menu.

- 1. Internals
- 2. System settings
- 3. Output 1
- 4. Output 2
- 5. Pressure
- 6. Flow
- 7. Temperature
- 8. Alarm 1
- 9. Alarm 2
- 10. PI Controller
- 11. Purging unit
- 12. AutoZero
- 13. Communication

When the desired parameter group is displayed, press the **PGM**-key to select the group for programming. The available parameters in the selected parameter group is displayed on the bottom row.

Use the arrow-keys to select which parameter to program and press the **PGM**-key.

# PARAMETER LIST

Internals	Nr	Lead text	Min	Max	Default
P00   SW: I/O   P01   SW: OPI   System settings			1	max	Doraut
P01   SW: OP    System settings   P03			Ι		
Post					
P03					
FLOW   GP+FLOW   SRC+CTRL   GP+TEMP   FLW+TEMP   FLOW   FLOW   GTRL   TEMP   FLOW   GTRL   TEMP   FLOW   GTRL   TEMP   FLOW   GTRL   TEMP   FLOW   GTRL   GLAW   GLAW			dD		dD.
P05	P03	Display	FLOW dP+FLOW SRC+CTRL dP+TEMP		dP
P06   Number of OPI   1   3   1	P04	Damping [s]	0,0	9,9	1,0
Dutput 1	P05	Access code	0000	9999	0000
P08	P06	Number of OPI	1	3	1
PLOW CTRL TEMP	Outp	ut 1			
P10   Signal mA   020	P08	Source	FLOW CTRL		dP
Source	P09		210		
P11					420
P12   Signal V   010   210   010   210   P13   Signal mA   020   420   420   Pressure   P15   MinCal [Pa]   P16   MaxCal [Pa]   P17   Unit dP   Pa / mbar / iwc   Pa   P18   Decimals   0   4   0   P19   Min range   MaxCal   P20   Max range   MinCal   P20   Max range   MinRange   MaxRange   MinCal   P21   Min out   MinRange   MaxRange   MaxCal   P22   Max out   MinRange   MaxRange   MaxCal   P23   Sign dP   POS / NEG   POS   POS   Flow   P24   Unit flow   I/s   m3/s   m3/h   m/s   cfm   P25   Decimals   0   4   0   0   P26   Max flow   0   32767   0   P27   Scale flw   0   32767   0   P28   Set flow   0   32767   0   P29   Compens   OFF   ACTUAL   NORMAL 0   OFF   OFF   OFF   OFF   OFF   O10V   210V   020mA   OFF   OFF   OFF   O20mA		ı	1		
P13   Signal mA   020	P11	Source	FLOW CTRL		CTRL
Name	P12	Signal V			010
P15         MinCal [Pa]         P16         MaxCal [Pa]         P2         P3         P4         P4         P5         P4         P5         P5<	P13	Signal mA			420
P16         MaxCal [Pa]         Pa / mbar / iwc         Pa           P17         Unit dP         Pa / mbar / iwc         Pa           P18         Decimals         0         4         0           P19         Min range         MinCal           P20         Max range         MaxCal           P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/h m/s cfm         I/s m3/s m3/h m/s cfm           P24         Unit flow         0         32767         0           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature         OFF O10V O20mA         OFF O10V O20mA	Press	sure			
P17         Unit dP         Pa / mbar / iwc         Pa           P18         Decimals         0         4         0           P19         Min range         MinCal           P20         Max range         MaxCal           P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/h m/s cfm         I/s m3/s m3/h m/s cfm         I/s m3/s m3/h m/s cfm           P25         Decimals         0         4         0         0           P26         Max flow         0         32767         0         0           P27         Scale flw         0         32767         0         0         0         P29         Compens         OFF ACTUAL NORMAL 0         OFF         OFF         OFF         0.10V 2.10V 0.20mA         0         0         0         0         0         0         0         0         0         0         0         0         0         0         0         0         0         0         <	P15	MinCal [Pa]			
P18         Decimals         0         4         0           P19         Min range         MinCal           P20         Max range         MaxCal           P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/s m3/s m3/s m3/h m/s cfm         I/s           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature         P30         Input         OFF O10V O20mA         OFF	P16	MaxCal [Pa]			
P19         Min range         MinCal           P20         Max range         MaxCal           P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/s m3/s m3/h m/s cfm         I/s           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature         P30         Input         OFF O10V O20mA         OFF	P17	Unit dP	Pa / mbar / iv	wc	Pa
P20         Max range         MaxCal           P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/s m3/h m/s cfm         I/s           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF O10V 210V 020mA	P18	Decimals	0	4	0
P21         Min out         MinRange         MaxRange         MinCal           P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/s m3/h m/s cfm         I/s           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature         P30         Input         OFF O10V 210V 020mA         OFF	P19	Min range			MinCal
P22         Max out         MinRange         MaxRange         MaxCal           P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/h m/s cfm         I/s m3/s m3/h m/s cfm           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF O10V 210V 020mA         OFF	P20	Max range			MaxCal
P23         Sign dP         POS / NEG         POS           Flow           P24         Unit flow         I/s m3/s m3/s m3/h m/s cfm         I/s m3/s m3/h m3/s m3/h m/s cfm           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF         OFF           Temperature         P30         Input         OFF O10V 210V 020mA         OFF	P21	Min out	MinRange	MaxRange	MinCal
P24	P22	Max out	MinRange	MaxRange	MaxCal
P24         Unit flow         I/s m3/s m3/h m/s cfm         I/s           P25         Decimals         0         4         0           P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature         P30         Input         OFF O10V 210V 020mA         OFF	P23	Sign dP	POS / NEG		POS
m3/s m3/h m/s cfm	Flow				
P26         Max flow         0         32767         0           P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF 010V 210V 020mA         OFF	P24	Unit flow	m3/s m3/h m/s		I/s
P27         Scale flw         0         32767         0           P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF 010V 210V 020mA         OFF	P25	Decimals	0	4	0
P28         Set flow         0         32767         0           P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF 010V 210V 020mA         OFF	P26	Max flow	0	32767	0
P29         Compens         OFF ACTUAL NORMAL 0         OFF           Temperature           P30         Input         OFF 010V 210V 020mA         OFF	P27		0	32767	0
ACTUAL   NORMAL 0				32767	+
P30 Input OFF 010V 210V 020mA	P29	Compens	ACTUAL		OFF
P30 Input OFF 010V 210V 020mA	Temp	erature			•
010V 210V 020mA			OFF		OFF
Pt-100L Pt-100H Pt-1000L Pt-1000H		прис	010V 210V 020mA 420mA Pt-100L Pt-100H Pt-1000L		
P31 Min Input [°C] -30 600 -30			-30	600	-30
P32 Max Input [°C] -30 600 80			-30	600	80
Alarm 1	Alarn	n 1			
P33 Mode OFF HIGH LOW OFF	P33	Mode	HIGH		OFF

Nr	Lead text	Min	Max	Default
P34	Source	dΡ		dP
		FLOW TEMP		
P35	Limit	MinRange	MaxRange	0
P36	Delay [s]	0	3600	0
P37	Reset	MANUAL AUTO		AUTO
P38	Beeper	OFF ON		OFF
P39	Mute time [s]	0	3600	0
Alarn	n 2	•		
P40	Mode	OFF HIGH LOW		OFF
P41	Source	dP FLOW TEMP		dP
P42	Limit	MinRange	MaxRange	0
P43	Delay [s]	0	3600	0
P44	Reset	MANUAL AUTO		AUTO
P45	Beeper	OFF ON		OFF
P46	Mute time [s]	0	3600	0
PI Co	ntroller			
P47	Mode	OFF ON		OFF
P48	Source	dP FLOW TEMP		dP
P50	Temp 1 [°C]	-30	600	0
P51	SP 1	MinRange	MaxRange	0
P52	Temp 2 [°C]	-30	600	0
P53	SP 2	MinRange	MaxRange	0
P54	SPC Type	OFF TEMP		OFF
P58	NZ [%]	1	50	2
P59	P-band [%]	0	9999	0
P60	I-time [s]	0	999	10
P61	BZ [%]	0	100	0
P62	I-time BZ [s]	0	999	0
P79	Min flow	MinRange	MaxRange	0
P80	Max flow	MinRange	MaxRange	0
P63	Output	DIRECT REVERSE		REVERSE
P64	Min output [%]	0	100	0
P65	Max output [%]	0	100	100
_	ing unit			1
P69	Mode	OFF ON TEST		OFF
P70	On Time [s]	0	60	0
P71	Pause [s]	30	3600	30
P84	Output	Volt 1 mA 1		mA 1
Auto				
P81	Interval [h]	0,0	60,0	0,0
P85	Output	Volt 2 mA 2		mA 2
Comi	munication			
P73	Address	1	247	21
P74	Baud	OFF / 600	128000	38400
P75	Parity	NONE ODD EVEN		NONE
P76	Protect	NO		NO
L		YES		

## Programming of a numeric value

Each digit in a numeric value is programmed separately. Press **PGM** to begin programming. The selected digit is flashing. Press the up-arrow key for digits between 1 and 9. When passing digit "9", negative digits between -9 and 0 are shown if they are allowed in the parameter value. Confirm each digit by pressing the **PGM**-key. When all digits are programmed, press the **PGM**-key to save the new value. The entire row is flashing to confirm programming. To abort ongoing programming, press the **ESC**-key and then begin a new programming with the **PGM**-key.

**Note!** It is always possible to abort or cancel incorrect programming using the **ESC**-key unless you have pressed the **PGM**-key after programming the last digit.

## Programming of alternative units or values

Press the arrow-keys to select the desired alternative unit or value. Press the **PGM**-key to save the change. The entire row is flashing to confirm programming. **Note!** It is always possible to abort or cancel incorrect programming using the **ESC**-key unless you have pressed the **PGM**-key after selected unit/value.

## End programming mode

Press the **ESC**-key to return to parameter group selection display. Press the **ESC**-key a second time to close the programming menu and return to the start menu.

If no key has been pressed during 5 minutes, the program menu is closed automatically.

#### 1. INTERNALS

Displays the program versions for the I/O-board (motherboard) and Operator Interface (display).

No	Lead text	Min	Max	Default
P00	SW: I/O			
P01	SW: OPI			

#### 2. SYSTEM SETTINGS

General settings in MF-PFTT

No	Lead text	Min	Max	Default
P03	Display	dP FLOW dP+FLOW SRC+CTRL dP+TEMP FLW+TEMP		dΡ
P04	Damping [s]	0,0	9,9	1,0
P05	Access code	0000	9999	0000
P06	Number of OPI	1	3	1

- P03 Display, select start menu to display. Selecting 'SRC+CTRL' show the selected source (SRC) in the PI-controller + control output signal (CTRL).
- P04 *Damping*, programme, in seconds, the damping for the pressure output signal.
- P05 Access code, used for activating or deactivating the code lock, see page 7.
- P06 *Number of OPI*, number of operator interfaces connected. See separate instruction.

## 3-4. OUTPUT 1 och OUTPUT 2

Settings for the two output signals

No	Lead text	Min	Max	Default
P08	Source	dP FLOW CTRL TEMP	Max	dP
P09	Signal V	010 210		010
P10	Signal mA	020 420		420
P11	Source	dP FLOW CTRL TEMP		CTRL
P12	Signal V	010 210		010
P13	Signal mA	020 420		420

MF-PFTT has 2 output signals which can be set to either 0..10 Volt, 2..10 Volt, 0..20 mA or 4..20 mA. Both Volt and mA are simultaneously available for both outputs.

- P08/P11 Source, is used to select which measuring value/signal (source) to direct as output signal. 'dP' is the pressure signal, 'FLOW' is the flow signal, 'CTRL' is the control signal from the PI-controller and 'TEMP' is the actual temperature from the temperature sensor.
- P09/P12 Signal V is used to switch between 0..10
   Volt and 2..10 Volt output signal.
- P10/P13 Signal mA is used to switch between 0..20 mA and 4..20 mA output signal.

With activated purging function, the purging unit PU3 is connected to output 1 (Volt or mA) and the parameter (P09 or P10) is hidden in the parameter list. If the unit is fitted with built-in automatic zero-setting module MFM-ZP, it is connected to output 2 (Volt or mA) and the parameter (P12 or P13) is hidden in the parameter list. It is still possible to use the free output signal on both outputs for the selected source.

#### 5. PRESSURE

Settings for pressure measurement

Cottings for procedio modecuroment					
No	Lead text	Min	Max	Default	
P15	MinCal [Pa]				
P16	MaxCal [Pa]				
P17	Unit dP	Pa / mbar / iv	vc	Ра	
P18	Decimals	0	4	0	
P19	Min range			MinCal	
P20	Max range			MaxCal	
P21	Min out	MinRange	MaxRange	MinCal	
P22	Max out	MinRange	MaxRange	MaxCal	
P23	Sign dP	POS / NEG		POS	

## P15/P16 MinCal[Pa] / MaxCal[Pa],

The MF-PFTT is factory calibrated for a specific range. The range is written on a label located on the right side of the enclosure. The calibration is always in Pascal (Pa). *MinCal* and *MaxCal* is the calibrated pressure range in Pa. These values are notes and not possible to change.

- P17 Unit dP, Select in which unit to display the pressure. The alternatives are Pa, mbar or iwc (inch water column).
- P18 Decimals, Number of decimals to show for the pressure value. When using Pa as unit it is recommended not to use decimals.
  - In case any set value is above 32767 regardless of where the decimal point is placed the adjustment is not carried out.
  - E.g. If Set Point = 5000 and one decimal is selected, the adjustment will not work since the value 5000,0 is greater than the allowed max value of 3276,7. Of the same reason, 500,0 cannot be adjusted to 500,00.
- P19/P20 Min range / Max range
   When programming a new unit, min and max limits
   in the new unit are displayed in parameter Min
   range and Max range. These values are notes and
   not possible to change.
- P21 Min out, Lower limit for scaling the output signal is set in pressure units, e.g. 10 Pa will result at 10 Pa pressure the min output signal of, 0/2 V resp. 0/4 mA.
- P22 Max out, Higher limit for scaling the output signal is set in pressure units, e.g. 90 Pa will result at 90 Pa pressure the max output signal of 10 V resp. 20 mA.
- P23 Sign dP, If the transmitter is without zero crossing, the MF-PFTT will indicate a negative pressure similar to positive pressure (i.e. Without negative sign). When programming Sign dP = 'NEG' a negative sign (-) is shown in front of the current value.
- P81 AutoZero, Using the optional built-in solenoid valve, automatic zero adjustment can be set. The time between adjustment can be set between 0,1 and 60 hours. During this process, the displayed values and the output signals are halted. After the zero adjustment is done in approx. 15 seconds, the transmitter restore to normal operation.
   Zero adjustment can also be carried out manually according to instructions on page 8.

To change the range for the output signal, the *Min out* and *Max out* are programmed. Programmed values must be in the selected unit (Pa, mbar, iwc). When scaling, be aware that the accuracy is always in percent of the factory calibrated pressure range. To measure and control the flow or velocity it is necessary to connect the transmitter to flow sensors with a known formula and k-factor.

## 6. FLOW

To measure and control the flow or velocity it is necessary to connect the transmitter to flow sensors with a known formula and k-factor.

Settings for flow measuring.

No	Lead text	Min	Max	Default
P24	Unit flow	l/s m3/s m3/h m/s cfm		l/s
P25	Decimals	0	4	0
P26	Max flow	0	32767	0
P27	Scale flw	0	32767	0
P28	Set flow	0	32767	0
P29	Compens	OFF ACTUAL NORMAL 0		OFF

- P24 *Unit flow*, select a suitable unit for flow display, l/s, m3/s, m3/h, m/s or cfm (cubic feet / minute).
- P25 Decimals, Number of decimals to show for the flow value. In case any set value is above 32767 regardless of where the decimal point is placed the adjustment is not carried out.
  - E.g. if *Max Flow* = 5000 and one decimal is selected, the adjustment will not work since the value 5000,0 is greater than the allowed max value of 3276,7. Of the same reason, 500,0 cannot be adjusted to 500,00.
- P26 *Max flow,* set the flow that correspond to the pressure range on the MF-PFTT.
- P27 Scale flw, set the flow for max output signal, 10 V resp. 20 mA.
- P28 Set flow, Programme this parameter if adjusting the displayed flow is necessary. Programme the current flow using a reference flow measurement. Max flow is re-scaled to correspond with the reference measurement. If the unit is connected to a computer system or similar, the receiving system should also be programmed if the Scale flw value is higher than the new value of Max flow.
  - **NOTE!** Programming must be performed at the same time as when the reference value is measured (The **PGM**-key is pressed for the last digit and the value is stored).
- P29 Compens, with a connected temperature sensor, the measuring value can be recalculated from the standard temperature of 20°C to a flow at actual temperature, 'ACTUAL', -30...+600°C or to a flow at normal condition 0°C, 'NORMAL 0'.

The basic flow calculation used is made with  $\sqrt{dP}$ . To have the display and the output corresponding to the actual flow or velocity in the selected unit it is necessary to make some calculations.

Different manu factors of flow measurement devices have different calculation, but common for all is  $\sqrt{dP}$ . Use the actual formula to calculate the max flow for the factory calibrated measure range.

The calculated flow or velocity is then programmed under  $Max\ flow$  in the selected unit. E.g. 5,0 m³/s. It is possible to scale the flow range under  $Scale\ flw$ . When scaling the flow, note that the accuracy depends on the "Max flow" range.  $Scale\ flw$  must always be set to the same or a lower value than  $Max\ flow$ . E.g. 3,5 m³/s = 10 VDC. The output signal is linear to the flow or velocity.

## 7. TEMPERATURE

Settings for temperature measurement

No	Lead text	Min	Max	Default
P30	Input	OFF 010V 210V 020mA 420mA Pt-100L [LOV Pt-100H [HIO		OFF
		Pt-1000H [HI	)W]	
P31	Min Input [°C]	-30	600	-30
P32	Max Input [°C]	-30	600	80

- P30 Input, select type of temperature sensor.
   OFF = No measurement of temperature.
   0..10V, 2..10V = External Volt signal, must be scaled with P31 and P32.
   0..20mA, 4..20mA = External mA signal, must be scaled with P31 and P32.
   Pt-100 and Pt-1000 has 2 measuring ranges, LOW/HIGH (Pt-100L/Pt-1000L and Pt-100H/Pt-1000H)
   LOW is a measuring range of -30..80 °C and HIGH is a measuring range of 0..600 °C.
   P31 and P32 will be automatically programmed to the selected range when Pt-100 or Pt-1000 is selected as temperature sensor.
- P31/32 Min Input, Max Input, scaling. Using temperature sensors with external Volt / mA signal, programme the Min- and Max value of the calibrated measuring range.
   Using temperature sensors with Pt-100 or Pt-1000, the measurement range can be scaled within the

#### Output signal for temperature.

selected range, see P30.

For input signal with external Volt/mA signal, the same range as the input signal is obtained. Using sensors with Pt-100 or Pt-1000, the range of output signal is set by P31 and P32.

#### 8-9. ALARM 1 and ALARM 2

Settings for two alarm limits.

No	Lead text	Min	Max	Default
P33	Mode	OFF HIGH LOW		OFF
P34	Source	dP FLOW TEMP		dP
P35	Limit	MinRange	MaxRange	0
P36	Delay [s]	0	3600	0
P37	Reset	MANUAL AUTO		AUTO
P38	Beeper	OFF ON		OFF
P39	Mute time [s]	0	3600	0
P40	Mode	OFF HIGH LOW		OFF
P41	Source	dP FLOW TEMP		dP
P42	Limit	MinRange	MaxRange	0
P43	Delay [s]	0	3600	0
P44	Reset	MANUAL AUTO		AUTO
P45	Beeper	OFF ON		OFF
P46	Mute time [s]	0	3600	0

MF-PFTT has an alarm with two, each independent, alarm limits. The alarm is acoustic with buzzer and visual with LED (light emitting diode). Normal state is indicated with green LED and alarm state with red flashing LED on the lid. The acoustic alarm can be disabled for each alarm limit. Red LED is activated by the first alarm state that occur. At the alarm limit, the red LED is lit and after set time delay it begin to flash. The display show which of the alarm limits that triggered the alarm.

- P33/P40 Mode, select if the alarm should be triggered for high or low level. Programme as 'OFF' to deactivate monitoring.
- P34/P41 Source, Choose which measuring value to be monitored. 'dP' = pressure, 'FLOW' = flow 'TEMP' = temperature.
- P35/P42 *Limit*, set at which level the alarm to be triggered.
- P36/P43 *Delay* [s], set time delay before alarm state occur.
- P37/P44 Reset, 'MANUAL' if the alarm should be reset manually by pressing the ESC-key or 'AUTO' if the alarm state should return automatically to normal state when the level is back to normal.
- P38/P45 Beeper, 'OFF' disable the acoustic alarm. 'ON' if alarm state should sound.
- P39/P46 Mute time, is used to silence (mute) the alarm for a set time in seconds when the ESCkey is pressed. If the time is set to '0', the alarm is mute until the alarm is reset and a new alarm state occur.

#### 10. PI-CONTROLLER

Settings of PI-controller.

No	Lead text	Min	Max	Default
P47	Mode	OFF ON		OFF
P48	Source	dP FLOW TEMP		dP
P50	Temp 1 [°C]	-30	600	0
P51	SP 1	MinRange	MaxRange	0
P52	Temp 2 [°C]	-30	600	0
P53	SP 2	MinRange	MaxRange	0
P54	SPC Type	OFF TEMP		OFF
P58	NZ [%]	1	50	2
P59	P-band [%]	0	9999	0
P60	I-time [s]	0	999	10
P61	BZ [%]	0	100	0
P62	I-time BZ [s]	0	999	0
P79	Min flow	MinRange	MaxRange	0
P80	Max flow	MinRange	MaxRange	0
P63	Output	DIRECT REVERSE		REVERSE
P64	Min output [%]	0	100	0
P65	Max output [%]	0	100	100

MF-PFTT has a PI-controller specially made for pressure and flow control.

The controller could be programmed as a standard Plcontroller, but in most of the applications together with pressure and flow control we recommend to program it as an integral controller without P-band.

There are two programmable I-times. Outside a desired limit on both sides of the set point it is possible to have a shorter I-time and inside the limits a longer I-time. The PI-control signal is directed to a desired output in parameter group **Output 1** or **Output 2**.

- P47 Mode, 'ON' activates Pi-controller, 'OFF' disable the controller.
- P48 Source, select which measuring value to control. 'dP' = pressure, 'FLOW' = flow, 'TEMP' = temperature.
- P50 Temp 1, see chapter "Control applications".
- P51 SP 1, see chapter "Control applications".
- P52 Temp 2, see chapter "Control applications".
- P53 SP 2, see chapter "Control applications".
- P54 SPC Type, see chapter "Control applications".
- P58 NZ [%], select desired neutral zone, normally 1..5%. Half zone above and half below set point value. Set in percent of the measuring range.
- P59 P-band [%], normally not used for pressure or flow control, default 0%. If P-band is programmed to 0 % the P-function is disabled and the I-time is calculated for a P-band of 100%.
- P60 *I-time[s]*, set suitable I-time, normal 10s.
- P61 BZ [%], Break zone, used when you want to reduce the control speed when surrounding the set point.
- P62 I-time BZ, set I-time inside the break zone. Enter a longer I-time for a stable control when close to the neutral zone.
- P79 Min flow, see chapter "Control applications".
- P80 Max flow, see chapter "Control applications".
- P63 Output, direction of the control output signal.
   Normally 'REVERSE' (if the pressure or flow is

- above set point, the output signal will decrease).
- P64 *Min output*, set a lower limit for the control output signal in %.
- P65 *Max output*, set a higher limit for the control output signal in %.

## **Control applications**

The controlled unit can be selected as pressure, flow or temperature.

#### Fixed pressure or flow control:

Select pressure or flow in parameter 48, *Source*, and set desired set point in parameter 51, *SP 1*.

#### Temperature controlled pressure or flow control:

Select parameter 48, *Source*, as 'dP' or 'FLOW'. Set parameter 54, *SPC Type* to 'TEMP'.

Programme the lowest pressure or flow in parameter 51, *SP 1*, at set temperature in parameter 50, *Temp 1*. Programme the highest pressure or flow in parameter 53, *SP 2*, at set temperature in parameter 52, *Temp 2*.

#### Temperature control (VAV):

Select parameter 48, *Source*, as 'TEMP'. Set parameter 54, *SPC Type*, to 'OFF' and programme a desired temperature in parameter 51, *SP 1*, together with min and max flow in parameter 79, *Min flow* and parameter 80, *Max flow*.


The flow control point will float between the programmed values in parameter 79 and 80 to maintain the set temperature.

#### I-time

When programming as an I-controller there are two possibilities.

- The same I-time over the full range. Normally used.
   Program BZ = 000 and I-time BZ = 000. The I-time should normally be longer than the time for the damper motor etc. to go from min to max.
- Shifting between two I-times. The reason for working with two I-times is often that outside a set pressure or flow limit you want to have a fast response and inside a slow response (see figure).

**BZ**: limit for switching I-time. *BZ* is in % of the scaled pressure or flow range. The set break zone, *BZ*, is counted from the neutral zone, *NZ*, higher and lower limit. The set value is on each side of the neutral zone and moves with any changes in the neutral zone. If the control output is not entering a stable position, increase the I-time, you could also try to increase the neutral zone.

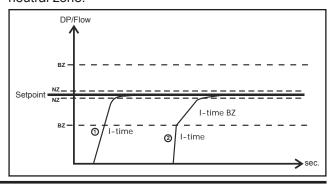

## Manual operation

Return to the start menu and select the display option where output signal for PI-controller together with pressure, flow or temperature is indicated. Which one that is displayed is determined by what the PI controller is programmed for.

"Flow / dP"
"AUTO 50.00 %"

Press **PGM**, 'AUTO' changes to 'HAND' and the output signal can be set in % using the arrow keys. Return to position 'AUTO' by pressing the **PGM**-key. To display the programmed start menu, press the **ESC**-key.

The display showing the text "PI-" in front of 'HAND' or 'AUTO' is not possible to use for manual operation.

#### 11. PURGING FUNCTION

Settings for the purging function with a connected purging unit, PU3.

No	Lead text	Min	Max	Default
P69	Mode	OFF ON TEST		OFF
P70	On Time [s]	0	60	0
P71	Pause [s]	30	3600	30
P84	Output	Volt 1 mA 1		mA 1

- P69 Mode, 'ON' activates the function and 'TEST' begin purging.
- P70 On Time, time in seconds for purging.
- P71 *Pause*, time in seconds between each purging.
- P84 Output, Select which output the PU3 is connected to.

#### 12. AUTOZERO

Automatic zero adjustment. This parameter group is only visible when solenoid valve MFM-ZP is installed.

No	Lead text	Min	Max	Default
P81	Interval [h]	0,0	60,0	0,0
P85	Output	Volt 2 mA 2		mA 2

Using the optional built-in solenoid valve, automatic zero adjustment can be set. During this process, the displayed values and the output signals are halted. After the zero adjustment is done in approx. 15 seconds, the transmitter restore to normal operation. Zero adjustment can also be carried out manually according to instructions on page 8.

- P81 *Interval[h]*, The time between adjustment can be set between 0,1 and 60 hours.
- P85 *Output*, Select which output the solenoid valve is connected to.

#### 13. COMMUNICATION MODBUS

Modbus RTU through RS-485 serial connection. This parameter group is only visible when communication module is installed.

No	Lead text	Min	Max	Default
P73	Address	1	247	21
P74	Baud	OFF / 600	128000	38400
P75	Parity	NONE ODD EVEN		NONE
P76	Protect	NO YES		NO

MF-PFTT can be fitted with a built-in expansion module (Option) for network communication with a computer.

- P73 Address, network address for MF-PFTT, factory default as 21.
- P74 Baud, transfer rate, factory default 38400 haud
- P75 *Parity*, Parity bit in data transfer. Factory default 'NONE'.
- P76 Protect, Protection for parameter programming through network communication. 'YES' = write protection. This parameter can only be set to 'NO' using the MF-PFTT keypad.

#### **CODE LOCK PROTECTION**

The code lock is used to protect against an authorized programming. A four-digit code must be entered to access the program menu and the functions menu. It is still possible to read measuring values and operating state without entering the access code.

At delivery, the code is set to '0000', unless otherwise agreed on. When the code is set to '0000', the code lock is inactivated and no protection against an authorized programming is present.

## **Activation**

To activate the code lock, a 4-digit code must be programmed in parameter P05 *Access code* which is found in parameter group **System settings**. The code can not be '0000', since this code is used to deactivate the function. When a code has been programmed and saved, the next time it will be necessary to enter the code to access the program menu and the functions menu.

## **Deactivating**

The code lock can only by deactivated in the program menu and therefore the access code must be available to deactivate the code lock. Set the parameter P05 *Access code* to '0000'. The parameter is found in the parameter group **System settings**.

Contact Micatrone if the code has been lost!

## **Entering the code**

To access the program menu or functions menu it is necessary to enter the access code. Example:

- Press the PGM-key to open the program menu. Press the PGM-key until "PROGRAM- MENU" is displayed.
- Release the **PGM**-key. Following text is displayed if key code is activated: "ENTER CODE:" and "0\*\*\*".
- The first digit of the access code can be entered using the arrow keys. When ready press the PGMkey to continue with the next digit. Repeat until all digits are entered.
- 4. When the 4 digits are entered, press the PGM-key a final time. The entered code is now compared with the programmed code in parameter P05 Access code. If the codes match, the program menu is displayed. The program menu is available until it has been exited using the ESC-key.
- If the entered access code is incorrect, the text "INVALID CODE" is displayed during 2 seconds. Restart from point 1.
- By pressing the ESC-key, the entering code operation is cancelled and the default start menu is displayed.

#### **FUNCTIONS MENU**

Functions that are not used frequently on daily basis are found in the functions menu. The functions menu is accessed by pressing simultaneously the **PGM** and **ESC**-key until the text "FUNCTIONS-MENU" is displayed. If code lock is activated, see page 7, a valid access code must be entered to access the menu.

Use the arrow keys to scroll through the different functions, when displayed, select the desired function by pressing the **PGM**-key. Exit the present menu by pressing the **ESC**-key.

#### **Functions**

- Serial number Display the serial number xxxxx-xxx.
- Date of cal. Display the latest factory calibration date.
- Reset Defaults Restore all data to the latest factory calibration.
  - List of params All values in the entire parameter list are restored to default values at factory delivery.
  - Calibrations All calibrations are restored to original values at factory delivery.

Note: field calibrations will be reset.

- Calibration
  - *Input*, five-point calibration of the pressure measurement
- Statistics Displays statistics for internal restarts.
- Power on, Number of normal power-on's.
- *Brown out*, Number of restarts due to poor supply voltage.
- Watchdog reset, Number of restarts due to runtime error.
- SW error reset, Number of restarts due to software error.
- Last reset cause, The cause for the latest restart.
- *Operating time*, Operating time since latest start. Shown in days, hours and minutes (d:hh:mm).

## Zero setting of pressure transmitter

Disconnect the pressure connections or place the block valve in position calibration.

Press the **ESC**-key until the start menu is displayed.

Press simultaneously on both arrow keys, keep pressed until the display show:

ZERO OFFSET

Release the keys when following is shown:

ZERO OFFSET ADJUSTING

When the zero setting is done, the display show:

ZERO OFFSET DONE

Followed with the start menu.

If the transmitter is equipped with built-in auto zero module, manual zero setting is done using the arrow keys without the need to detach any tubes or changing position of a connected mono block valve.

#### Calibration of MF-PFTT

MF-PFTT can be re calibrated against a pressure reference.

- 1. Keep **PGM** and **ESC pressed** until following text is displayed: "FUNCTIONS-MENU".
- 2. Scroll using the arrow keys until "Calibration" is displayed.
- 3. Press **PGM**. 'Input' is shown.
- 4. Press PGM. 'Cal dP' is shown.
- 5. Press **PGM**. The first calibration point is shown. Example: MF-PFTT (-50..50 Pa)

 $Pnt \ 1(5) = -50$ 

- 6. Connect shown pressure. In this case, 50 Pa, to the pressure connection marked negative [-].
- 7. Press the PGM-key and the MF-PFTT will start to measure the first calibration point (9 measurements).
- 8. Press the PGM-key to continue with the second calibration point, **ESC** aborts the calibration.
- 9. Proceed with all five calibration points and be careful to connect to the correct pressure connection.
- 10. When all calibration points are done, following text is shown:

"PGM=OK/ESC=ABORT"

- 11. The PGM-key will confirm the calibration and store the new calibration values.
- 12. The **ESC**-key will abort and cancel the calibration. Press repeatedly on the **ESC**-key to return to the start menu again.

Note! The pressure reference should comply with the demand of desired accuracy in the measurement.

## **TECHNICAL DATA:**

**Display:** Alphanumeric LCD

2 row, 2x16 characters

with backlight

Power supply:  $24 \pm 15\%$  VAC

20...32 VDC

**Pwr consumption:** Max 3 VA (24VAC)

**Pressure range:** see label on enclosure.

Flow range: (max 4 decimals) I/s 0...32767 m3/s 0...32767 m3/h 0...32767 m/s 0...32767 cfm 0...32767

**Measurement error:**  $< \pm 0.5 \%$  of the pressure

range ± 0,5 Pa

**Temperature drift:**  $< \pm 0.5 \% /10 \degree C$ 

**Damping:** 0,0...9,9 sec.

**Temp input:** Sensor Pt-100, Pt-1000 and

0/2..10VDC or 0/4..20mA

Output signal: Two analogue outputs,

0/2...10 VDC, 0/4...20 mA selectable and scalable. Both mA and Volt output can be used simultaneously

Ambient temp: 0...50°C

Alarm: Two separate alarms for

high & low level, alarm indication with red LED and

buzzer (joint)

Degree of protection: IP 65, ABS plastic

El-connection,

- Motherboard: 1 x 2,5 mm² / terminal - PFTT module: 1 x 1,5 mm² / terminal

Cable entries: 4 pcs M16x1.5mm

(glands not included)

**Dimensions:** WxHxD = 122x120x90 mm

Weight: 0,86 kg

#### **MAINTENANCE:**

Check zero settings every 6:th. month.


#### **ACCESSORIES:**

- Mounting kit for recessed mounting, MFM-PANEL
- External transformer 24, 115, 230 VAC
- MODBUS communication module
- · Solenoid valve for automatic zero-setting.

## **EMC/LVD/RoHS II:**

AB Micatrone declare under sole responsibility that MF-PFTT is in conformity with the essential requirements in the EMC-, the LVD- and the RoHS II directive. The full text of Manufacturers declaration of conformity is available on Micatrones website.

#### **Electrical connection:**

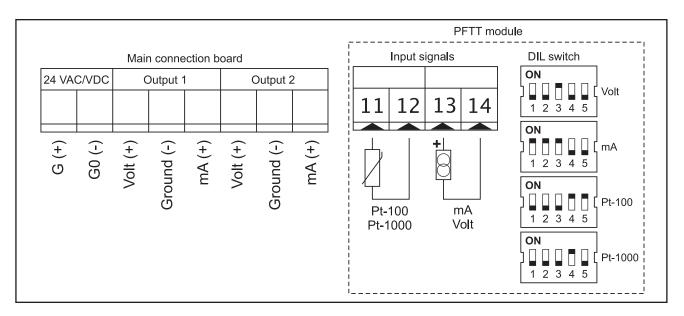



## Hitma Instrumentatie

www.hitma-instrumentatie.nl info@hitma-instrumentatie.nl +31 (0)297 - 514 833

# België / Belgique

www.hitma-instrumentatie.be info@hitma-instrumentatie.be +32 (0)2 - 387 28 64